# ZW3D 2017 Equation Manager Speeds up the Parametric

## **Modeling Process**

At the beginning of product design, the size and the shape of the model are usually uncertain, which need to be modified after various analysis and manufacture programming. Therefore, the model is supposed to be easy to modify. The parametric design nicely meets this requirement.

The parametric design is a design method based on dimension-driven feature modeling, which uses variables and equations to drive size of the model and control the shape. So variables and equations play important roles in parametric design.

The upgraded equation manager in ZW3D 2017 (Figure 1), with a lot of improved functions, helps users quickly create, manage and call variables. In addition, variables can also be imported from an Excel file and exported to an Excel table, being convenient to exchange data with ZW3D on other computers.

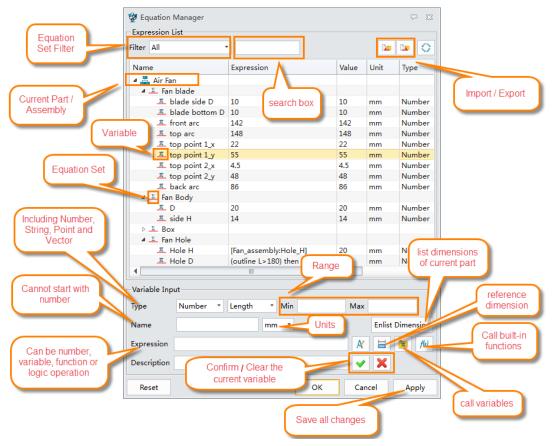


Figure 1. New Equation Manager Form



Next, we will introduce the related key points, including the creation of variable and equations, excel application, and parametric modeling.

### 1. Create Variables

Method 1: Directly create variables

In simple cases, users can directly create variables in the equation manager (Figure 2).

🐲 Equation Manager				⊽ ⊠
Expression List				
Filter All	·			🕨 🐚 🗘
Name	Expression	Value	Unit	Туре
A A Part001				
X:A Inner D	20	20	mm	Number
•	1111			•
	1111			
Variable Input				
Type 1 Number 🔹	Length 🔹 Mir	ו ו	Max	
Name 2 Inner D	mm *			Enlist Dimension
Expression 20	3		X	fk)
Description			4 🗸	×
Reset		ОК	Ca	ncel Apply

Figure 2. Directly Create the Variable

#### Method2: Create variables in equation set

In ZW3D 2017, there is a newly-added equation set function in Equation Manger, which is used to group variables. Right click the blank area of list, then create a new equation set. For the complex product design, users can create multiple equation sets to manage variables according to different features of the model (Figure 3).

2





Expr	ession List				
ilter	All	·			
Nam	-	Expression	Value	Unit	Туре
⊿ 📇	Air Fan				
⊿	Σ Fan blade				
	<u>π</u> blade side D	10	10	mm	Number
	<u>π</u> blade bottom D	10	10	mm	Number
	<u>π</u> front arc	142	142	mm	Number
	π top arc	148	148	mm	Number
	π top point 1_x	22	22	mm	Number
	π top point 1_y	55	55	mm	Number
	π top point 2_x	4.5	4.5	mm	Number
	π top point 2_y	48	48	mm	Number
	π back arc	86	86	mm	Number
$\triangleright$	Σ Fan Body				
$\triangleright$	Σ Box				
	Create Equation Set				
	Collapse All				
	Expand All	1111			
	Customize				
Varia	ible Input	_			
Гуре	Number 🔻	Length	Min	1	Max
Nam	e	m	m 🔻		Enlist Dimensio
	ession				A 🗎 🗖 f
LAPIG	551011				
Desc	ription				✓ X

Figure 3. Create Equation Set

Double click to activate one equation set, then create the variables in this equation set (Figure 4).

				D= D=	
Name	Expression	Value	Unit	Туре	-
🛚 📇 Air Fan	Double click				
Fan blade					
— <u>π</u> blade side D	10	10	mm	Number	
<u>π</u> blade bottom [	0 10	10	mm	Number	
$\pi$ front arc	142	142	mm	Number	
$\pi$ top arc	148	148	mm	Number	
<u>π</u> top point 1_x	22	22	mm	Number	
<u>π</u> top point 1_y	55	55	mm	Number	
<u>π</u> top point 2_x	4.5	4.5	mm	Number	
<u>π</u> top point 2_y	48	48	mm	Number	
X:A back arc	86	86	mm	Number	
🛯 🚨 Fan Body					
<u>π</u> D	20	20	mm	Number	
<u>π</u> side H	14	14	mm	Number	L
Δ Eox					
<u>π</u> outline L	200	200	mm	Number	
• • • • • •					•
/ariable Input					
ype 2 Number 🔻	Length - N	lin	Max	c	
lame 3 back arc	mm	•		Enlist Dime	ensio
xpression 86	4		A	/ 🖂 🙃	fla
			5		

Figure 4. Create Variable in Equation Set





## 2. Multi-import/export of Variables

Users can also create variables in an Excel file, then import them into ZW3D. In this way they can greatly increase efficiency of defining variables and shorten the period of parametric design (Figure 5).

Expression List	Imp	oort fro	m Exce	el file 🔪 👝		Export to Excel	table			
ilter All							× · · ·			
Name	Expression	Value	Unit	Туре	B1		$\times \checkmark f_x$			
🔺 📥 Air Fan				-		A	B	С	D	
Δ Fan blade				-	1	Parent Equa	Variable name	Expressio	Valu	Uni
<u>π</u> blade side D	10	10	mm	Number	2	Fan blade	blade side D	10	10	mm
<u>π</u> blade bottom D	10	10	mm	Number	3		blade bottom D	10	10	mm
<u>π</u> front arc	142	142	mm	Number	4		front arc	142	142	mm
$\pi$ top arc	148	148	mm	Number	5		top arc	148	148	mm
top point 1_x	22	22	mm	Number	6		top point 1_x	22		mm
top point 1_y	55	55	mm	Number						
top point 2_x	4.5	4.5	mm	Number	7		top point 1_y	55		mm
<u>π</u> top point 2_y	48	48	mm	Number	8		top point 2_x	4.5	4.5	
<u>π</u> back arc	86	86	mm	Number	9		top point 2_y	48	48	mm
🖉 🚨 Fan Body					10		back arc	86	86	mm
<u>π</u> D	20	20	mm	Number	11	Fan Body	D	20	20	mm
<u>π</u> side H	14	14	mm	Number	12		side H	14	14	mm
⊿ <u>Σ</u> Box					13	Box	Inner D	146	146	
TInner D	146	146	mm	Number		DOX				
<u>π</u> outline L	200	200	mm	Number	14		outline L	200	200	
<u>π</u> outline side H	20	20	mm	Number	15		outline side H	20	20	mm
⊿ 🔟 Fan Hole					16	Fan Hole	Hole H	[Fan_assem	20	mm
T Hole H	[Fan_asse		mm	Number	17		Hole D	(outline L	20	mm
T Hole D	(outline L	20	mm	Number	18					

Figure 5. Import/Export of Variables

## 3. Call Variables

The defined variables can be called by the variable browser at any time.

### 1) Call variables in sketch

After drawing the sketch outline, the constraints and dimensions should be added. During dimension definition or modification, the variables can be called to define the dimension value, as shown in figure 6. All variables are listed in the variable browser.

The parametric sketch, which should be well-defined to avoid failed update, changes with variables. This is the basis of the parametric modeling.

4

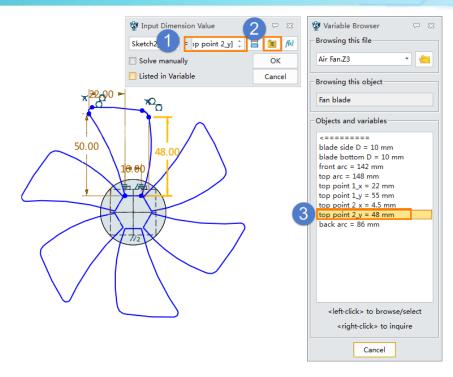


Figure 6. Call Variables in Sketch

### 2) Call variables in a single-part environment

During modeling, the variable can be used in any feature to define the model size and position. In the value input, the expression can be selected from the right menu. Then we can use the variables or expression to define the feature values, see figure 7.

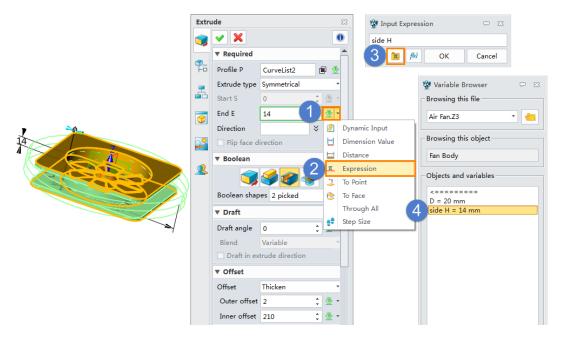


Figure 7.Call Variables in Single-part Environment



### 3) Call variables from external part

ZW3D 2017 supports calling variables from not only the current part but also external. In the variable browser, an option allows to browse variables from external part, as shown in figure 6.

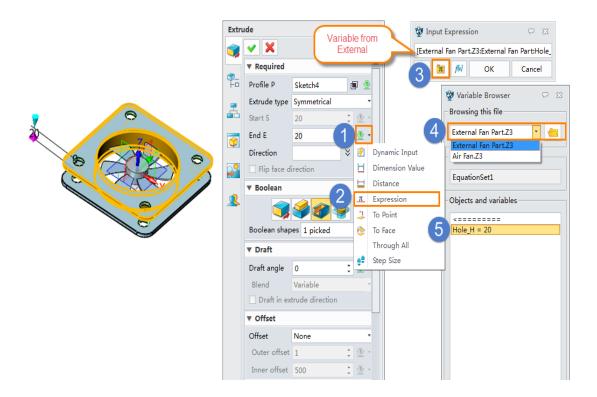


Figure 8. Call Variables from External Part

### 4) Check back variables in equation manager

Variables called in sketch or from external will be listed in different variable types in the equation manager according to their sources. ZW3D 2017 provides a new filter to filtrate different types of variables so that users can quickly check back the infiltrated variables (Figure 9).



	uation M	-							₽ 33
Expre	ession Li	st							
Filter	With Ext	ernal	-					2	
	With Ext	d Equatio ernal	n	Expression			Value	Unit	Туре
4.	Σ Fan H		_	15			20		N. I
	<u>π</u> Ho	le H		[Fan_ass	embly:Hole_H	-1]	20	mm	Number
									•
	ble Input						<b>.</b> .		
Туре		Number	- I	Length	▼ Min		Max		
Name	•				mm *			Enlist	Dimension
Expre	ssion						X		<b>π</b> f(x)
Descr	ription						<ul> <li>✓</li> </ul>	×	
Res	set					ОК	Can	cel	Apply

Figure 9. The Filter Helps Inquire Variables

## 4. Verify the availability of the parameterized modeling

Variables created in the equation manager will be shown in history manage. Double click to quickly edit the variable. After modification, user should manually regenerate the model to finish the update and check the availability of the parameterized modeling (Figure 10).

Man	ager 🛛 🕄	3	+ Air Fan.Z3	- [Air Fan] 🗙	+	
<b>₽</b> _	Show Most 🔹		🐲 Create/edi	t variable		⊽ ⊠
	📇 Air Fan		Variable			
	Solid(2)		variable			
<b>_</b>	4 🛅 Expression(16)		Туре	Number *	Length	·
	🛯 🚨 Fan blade					
7	<u>π</u> blade side D = 10 mm		Name	top point 1_y	mm	•
	<u>π</u> blade bottom D = 10 mm		Expression	55	M	🔚 📆 f(x)
	$\pi$ front arc = 142 mm		Expression	22	X	
	$\pi$ top arc = 148 mm		Description			
-	$\pi$ top point 1 x = 22 mm					
	$\pi$ top point 1_y = 55 mm			Reset	ок	Cancel
<u> </u>	$\pi$ top point 2_x = 4.5 mm			leset		Cancer
	$\pi$ top point 2_y = 48 mm					
	<u>π</u> back arc = 86 mm	_			-	
	🖉 🔟 Fan Body				$\circ$	
	<u><math>\pi</math></u> D = 20 mm	_				
	<u>π</u> side H = 14 mm				-3 m	
	▷ <u>Σ</u> Box	_				$\lambda$
	🖉 🚨 Fan Hole		$( \bigcirc$			
	<u>π</u> Hole H = [FanH] = 20 mm <	-				
	<u>π</u> Hole D = (outlelse 0 = 20 mm		6 Ol		4 ×	
	4 🛅 History	_			_	
	🗹 🔢 XY				0	
	🛃 🔢 XZ			1	3	
	VZ					
	🖌 🌿 Sketch1					

Figure 10. Quick-edit the Variable



7



Based on a parametric model, in ZW3D users can customize a reused part library, which can be

inserted as a component at any time (Figure 11).

😨 Part Lib	rary			ç	23						
Air Fan					<u> </u>						
	345.009 ı	nm									
blade side	D	10			•						
blade botto	om D	10	10 -								
front arc		142 *									
top arc		148 *									
top point 1	_x	22 *									
top point 1	_y	55 *									
Use sim	plified repres	entation									
Name		Air	Fan.1								
Number		00	01								
Create t	he part in a r	ew file									
	ОК	Canc	el								

Figure 11. Reused Part Library

This article shows you how to use ZW3D 2017 new equation manager in parametric design. General process of parameterized modeling has been introduced. In ZW3D 2017 users can quickly define variables, call them at any time and at anywhere, manage them with groups, and fast-edit them in history manager.

Please try ZW3D 2017 to experience more new features, such as dynamic section view and new sheet metal tools.

